Miniature Fuses

(Mini Fuse)

SPT478 Series, Time-Lag, Plastic Case

a Therm



Description

Sub-miniature fuse, Time-Lag, designed to IEC & UL standards.


Features

- Miniature Size
- Time-Lag
- Surge Protection
- Designed to IEC 60127-3 Sheet 4, GB/T 9364.3 Sheet 4
- RoHS & REACH Compliant


Applications

- Power Supply
- Household Appliance
- General Lighting
- Smart Home
- Office Equipment
- Electric Tool
- Medical Equipment


Structure Diagram

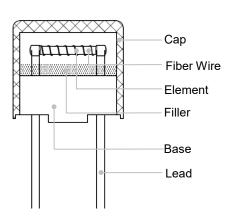

Dimensions (mm)

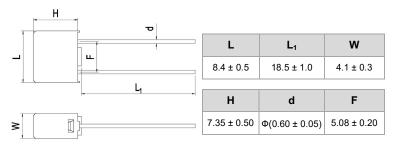

Part Numbering System

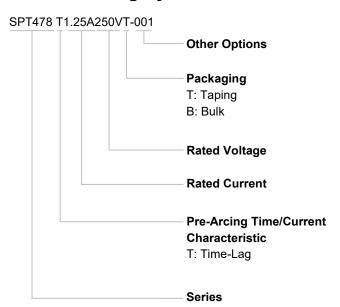

Agency Approvals

Agency Approvals	Agency File Number	Ampere Range (A)
c FL °us	on request	0.1 to 10
	on request	0.1 to 10
PS	on request	1 to 5 6.3 to 10
(1)	on request	0.1 to 10
	on request	0.1 0.125 to 0.8 1 to 2.5 3.15 to 6.3 8 to 10



SPT478 Series, Time-Lag, Plastic Case

Glossary

Glossary	
ltem	Description
Fuse	An overcurrent protective device with a fusible link that operates and permanently opens the circuit on an overcurrent condition.
Rated Current	The rated current of a fuse identifies its current-carrying capacity based on a controllable set of test conditions. Each fuse is marked with its rated current.
Rated Voltage	A maximum open circuit voltage in which a fuse can be used, yet safely interrupt an over-current. Exceeding the voltage rating of a fuse impairs its ability to clear an overload or short circuit safely.
Ampere Squared Seconds <i>I</i> ² <i>t</i>	The melting, arcing, or clearing integral of a fuse, termed l^2t , is the thermal energy required to melt, arc, or clear a specific current. It can be expressed as melting l^2t , arcing l^2t or the sum of them, clearing l^2t .
Time-current Characteristics	Under stated conditions of operation, the value of time as a function of the prospective current.
Rated Breaking Capacity	Value (r.m.s. for a.c.) of prospective current that a fuse-link is capable of breaking at a stated voltage under prescribed conditions of use and behaviour.



SPT478 Series, Time-Lag, Plastic Case

Specifications

	Max. Sustained		Max. Sustained	Typical	Agency Approvals				Environmental		
Model	Rated Current	Voltage Drop ^a	Power Dissipation at 1.5 I _N	Melting I²t b	(W)			PSE	c 91 0° us	RoHS	REACH
	(A)	(mV)	(mW)	(A ² Sec)	ccc	VDE	KC	PSE	cURus		
SPT478T100mA	0.1	350	170	0.04	•	•	•		•	•	•
SPT478T125mA	0.125	300	180	0.07	•	•	•		•	•	•
SPT478T160mA	0.16	280	190	0.11	•	•	•		•	•	•
SPT478T200mA	0.2	260	200	0.16	•	•	•		•	•	•
SPT478T250mA	0.25	240	220	0.29	•	•	•		•	•	•
SPT478T315mA	0.315	220	250	0.50	•	•	•		•	•	•
SPT478T400mA	0.4	200	280	0.91	•	•	•		•	•	•
SPT478T500mA	0.5	190	310	1.51	•	•	•		•	•	•
SPT478T630mA	0.63	180	360	2.38	•	•	•		•	•	•
SPT478T800mA	0.8	160	430	3.78	•	•	•		•	•	•
SPT478T1A	1	140	500	9.00	•	•	•	•	•	•	•
SPT478T1.25A	1.25	130	600	13	•	•	•	•	•	•	•
SPT478T1.6A	1.6	120	730	18	•	•	•	•	•	•	•
SPT478T2A	2	100	870	35	•	•	•	•	•	•	•
SPT478T2.5A	2.5	100	1000	49	•	•	•	•	•	•	•
SPT478T3.15A	3.15	100	1200	66	•	•	•	•	•	•	•
SPT478T4A	4	100	1400	112	•	•	•	•	•	•	•
SPT478T5A	5	100	1500	165	•	•	•	•	•	•	•
SPT478T6.3A	6.3	100	1650	250	•	•	•	•	•	•	•
SPT478T8A	8	80	1800	416	•	•	•	•	•	•	•
SPT478T10A	10	75	2000	750	•	•	•	•	•	•	•

a: Max. Voltage Drop (voltage drop is measured at (23 ± 1) °C ambient temp. at rated current).

Breaking Capacity:

CCC / VDE / PSE / KC: 35 A @ 250 VAC or 10 $\it I_{\rm N}$ @ 250 VAC Whichever is Greater

UL / cUL: 150 A @ 125 VAC / 250 VAC / 300 VAC / 350 VAC / 400 VAC

b: I^2t value is measured at 10 I_N .

Miniature Fuses


SPT478 Series, Time-Lag, Plastic Case

(Mini Fuse)

Opening Time / Current Characteristic

Rated Current	ated Current 2.1 <i>I</i> _N 2.75 <i>I</i> _N		4I _N		10 <i>I</i> _N		
(A)	Max.	Min.	Max.	Min.	Max.	Min.	Max.
0.1 to 6.3	2 minutes	400 ms	10 s	150 ms	3 s	20 ms	150 ms
8 to 10	5 minutes	1 s	20 s	150 ms	3 s	20 ms	150 ms

Time Current Curve (For Reference Only)

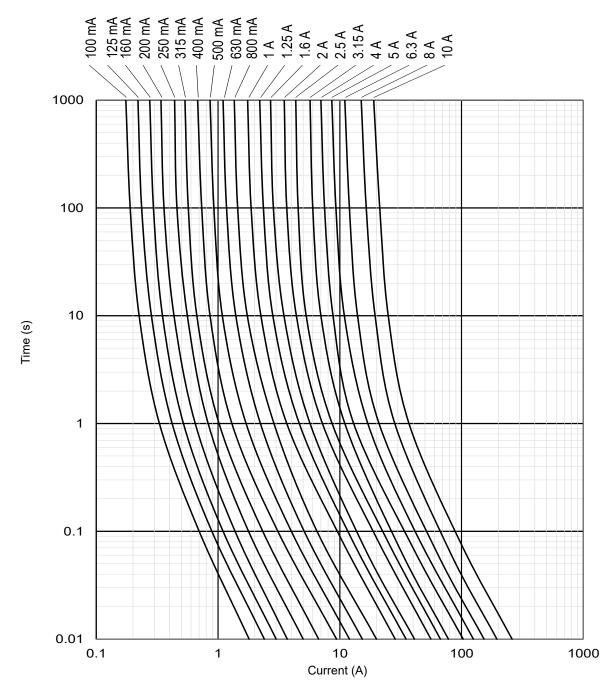



SPT478 Series, Time-Lag, Plastic Case

Reliability Test


No.	Items	Inspection Standards	Standards
1	High Temp. Test	Test Condition: Temperature: (105 ± 2) °C Time: 1000 hours Test Requirement: After the test, the voltage drop shall not have changed by more than 10% of the value measured before the test. The clearing time of the fuse shall be in range.	MIL-STD-202(Test Method 108) GJB360B(Test Method 108)
2	High Humidity Test	Test Condition: Temperature: (40 ± 2) °C Humidity: 90% to 95% Time: 96 hours Test Requirement: After the test, the voltage drop shall not have changed by more than 10 % of the value measured before the test. The clearing time of the fuse shall be in range.	MIL-STD-202(Test Method 103) GJB360B(Test Method 103)
3	Thermal Shock Test	Test Condition: Per Cycle: -40 °C / 30 minutes, 85 °C / 30 minutes Time: 10 Cycles Test Requirement: After the test, the voltage drop shall not have changed by more than 10 % of the value measured before the test. The clearing time of the fuse shall be in range.	MIL-STD-202(Test Method 107) GJB360B(Test Method 107)

Installation

Mechanical stress

Do not apply mechanical stress to the fuse body during or after the installation.

Wave soldering Parameters (For Reference Only)

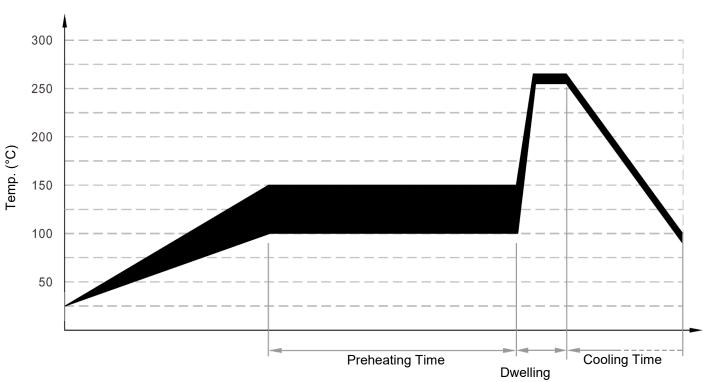

ltem	Temp. (°C)	Time (s)
Preheating	100 to 150	60 to 180
Dwelling	260 ± 5	2 to 5


Recommended Hand-Soldering Parameters

Solder Iron Temp.: (350 ± 5) °C

Heating Time: 5 seconds Max.


SPT478 Series, Time-Lag, Plastic Case

Temperature Derating Curve

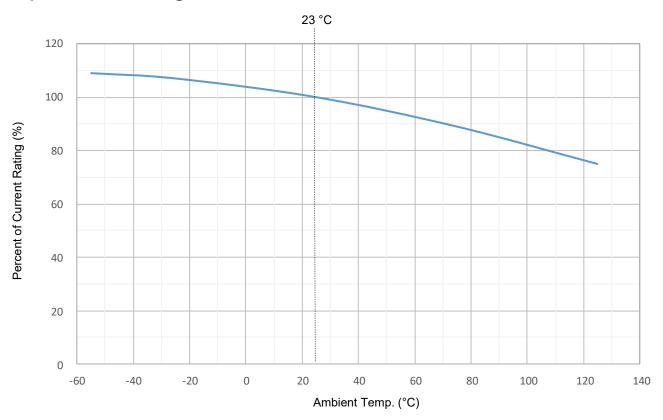


Packaging Information

All dimensions in mm

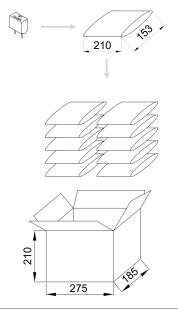

Bulk Short Leads (≤ 6.0 mm)				
Item PE Bag Carton				
Quantity (PCS)	10,000			
Gross W	3.2×(1±10%)			

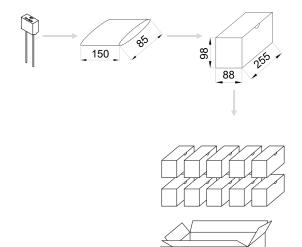

Bulk Long Leads (≥ 18.5 mm)				
Item PE Bag Box Carton				
Quantity (PCS)	1,000	2,000	20,000	
Gross Weigl	ht (kg)	7.8×(1	±10%)	


455



SPT478 Series, Time-Lag, Plastic Case

Packaging Information

All dimensions in mm

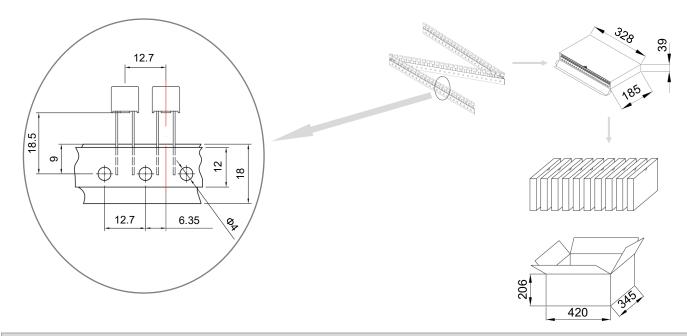

Taping					
ltem	Вох	Carton			
Quantity (PCS)	1,000	10,000			
Gross Weight (kg)	6.0×(1±10%)				



SPT478 Series, Time-Lag, Plastic Case



ATTENTION

Inspection

Cold Resistance Test

- a. Applied current shall be less than 10% of rated current, at ambient Temp. of (23±2) °C.
- b. (4-Wire) Resistance Measurement.

Usage

- a. Do not touch the fuse body or lead wire when power on, avoiding scald or electric shock.
- b. Air pressure is 80 kPa to 106 kPa. These values represent an altitude of +2000 m to -500 m, respectively.

Replacement

For safety reasons, the Fuse is the non-resettable product, please ensure that the alternative Fuse is the same type when replace it

Storage

Please store the fuse in the environment without high temperature, high humidity or corrosive gas, to avoid reducing the solderability of the lead wire. Please use them up within 1 year after receiving the goods.